




# Technical Bulletin 201201

[www.jcmglobal.com](http://www.jcmglobal.com)

The JCM Global Website provides the tools required to service all of our products. This includes a Software information database containing DIP Switch information, Customer Notifications, Product Manuals, Diagnostic Applications and more.

## Parts are Parts

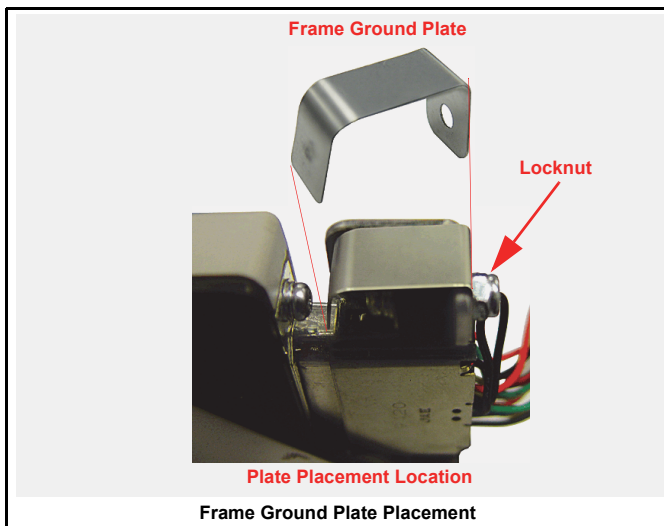

**Part No.** EDP # 151784

**Description:** Frame FG (Frame Ground) Plate

**Usage:** This Plate provides a solid Earth ground for the elimination of static charges on the iVIZION Unit. The Frame FG Plate is located on the Upper Frame Cable Mounting Screw assembly covering the top of the Cable Harness. It is attached in place with a Locknut.

**Note:** If the Frame FG Plate is not installed, or does not make firm contact with the iVIZION Transport Assembly, static electricity will not have a clean discharge path, and could affect the performance of the iVIZION Acceptor. It is very important that Validators have good Frame Ground connections.

## Latest JCM Software Listing

UNIT	Country	ID*	Version†	Check Sum	CRC
UBA-10/11-SS	USA	ID-003	V2.08-31	3EA6	2FOA
UBA-10/11-SS	USA	ID-024	V2.08-17	19A2	39B7
UBA-14/24-SS/SU	USA	ID-003	V-2.08-23		6B08
UBA-14/24-SS/SU	USA	ID-0G8*	V-2.08-66		31E6
UBA-14-SS & UBA-24-SS/SU	USA	ID-024	V2.08-28		6359
UBA-14-SS & UBA-24-SS/SU	USA	ID-028*	V2.08-18		1866
UBA-25-SS/SU	USA	ID-024*	V2.05-28	2CB2	
UBA-25-SS/SU	USA	ID-028*	V2.06-18	05D6	
WBA-12/13-SS	USA	ID-003	V-3.80-32i†	0ABC	
WBA-12/13-SS	USA	ID-044*	V-3.75-05i†	D716	
WBA-12/13-SS	USA	ID-024*	V-3.80-34	D1F3	
UBA-10/11-SS	EUR	ID-003*	V-2.05-28	57C9	
UBA-10/11-SS	SWE	ID-003*	V-2.05-20	A3E5	95B2
UBA-10/11-SS	ZAF	ID-003	V-2.05-20	E57F	2F46
UBA-10/11/12-SS	BWA	ID-003*	V-1.96-20	D605	3342
UBA-10/11/12-SS	BGR	ID-003*	V-2.05-20	DA20	21D1
UBA-10/11/12-SS	NAM	ID-003*	V-2.05-20	D12C	A4C1
UBA-10/11/12-SS	TUR	ID-003*	V-2.05-24	557D	C70D
UBA-10/11/12-SS	DNK	ID-003	V-2.07-24	84B2	
UBA-10/11/12-SS	DNK+EUR5	ID-003E*	V-2.07-24	C19A	A0A3
UBA-10/11/12-SS	BIH	ID-003*	V-2.05-20	88F1	D73A
UBA-14-SS & UBA-24-SS/SU	EUR5	ID-003*	V-1.95-20		2BB1
UBA-14-SS & UBA-24-SS/SU	ZAF	ID-003*	V-2.05-20	C3AC	0653
UBA-14-SS & UBA-24-SS/SU	GBR+SCO	ID-003*	V-2.06-21		6B08

\* . an asterisk signifies this ID# does not appear on the JCM Web Site.

† . an "i" suffix indicates Intelligent Cash Box Option compatibility.

The list of JCM Banknote Validator Software provided herein notifies Customers of the latest Software Versions developed. However, the listing does not identify Versions approved by Gaming Jurisdictional Authorities for actual use. Customers should always consult the JCM's Parts Sales Departments concerning approved Versions for use in their specific jurisdictions intended for operation.

## Current Service Manual Releases

Product	Revision	Product	Revision
DBV-30X	4	UBA 10/11/14/24/25	3a
EBA-03	2	WBA-1X2X	1
ICB	3	DT-200 BlueWave 2	2
Tiako (PUB-7/11)	2	iVIZION	2
TSP-02	D	UBA-RC	A
EBA-3X	4	TBV	1*

\* NOTE: Release updated this Month.

## Save Time and Labor with JCM's Latest Intelligent Cash Box System

The ICB® (Intelligent Cash Box) system is a unique cash management system that allows the operator to track a Cash Box and its contents through the entire cash process. The ICB system eliminates the need for dedicating Cash Boxes to specific machines, or putting barcode identification labels on the Cash Boxes. The Cash Boxes are tracked electronically eliminating most variance issues, and with the custom reports provided to each department, accuracy and efficiency is greatly improved.





# FREE REGIONAL TRAINING

Give your technicians the tools they need to keep your customers happy and your equipment running at peak efficiency.

For the local and regional training schedule visit:

<http://www.jcmglobal.com>

Technical Bulletin 201201 January 2012

## Technical Tips

**Question:** How are JCM USB Drivers installed on a Computer running a Windows® 7 - 32 or 64-bit Operating System?

**Answer:** JCM has released a Windows® 7 USB Device Driver for use with the UBA®, iVIZION®, TBV™, Vega™, iPRO™ and UBC™ Series of Validators.

To load and install the JCM USB Drivers for a PC running the Windows® 7 Operating System Proceed as follows:

1. Load the application on the Windows® 7 PC.
2. Extract the JCMUSBDriverSetup.exe File from the Compressed File Folder.
3. Run the "JCMUSBDriverSetup.exe, complete the installation for "JCM-SBDriver", File by following the defaults as presented.

When one of the supported JCM Validators is connected, let the PC automatically search for its appropriate Device Driver. When found the required Drivers will be automatically loaded onto the PC.

To obtain the JCM USB Drivers for the Windows® 7 OS Platform, contact JCM Technical Support at [techsupport@jcmglobal.com](mailto:techsupport@jcmglobal.com), or call (702) 651-0000.



Typical USB Driver Installation Wizard Screen

JCM TECHNICAL SUPPORT CONTACTS		
<b>Headquarters (Japan)</b>		
Sales and Service	81-6-6703-8405	hq-jp@jcmglobal.com
<b>Europe, Africa, Russia, Middle East</b>		
Sales and Service	49-211-530645-0	hq-eu@jcmglobal.com
<b>Australia, Oceania</b>		
Sales and Service	61-2 9648 0811	ipayne@jcmglobal.com
<b>Southeast Asia</b>		
Sales and Service	853 28 72 2648	jim.teng@jcmglobal.com
<b>North/South America/Canada/Caribbean</b>		
Toll Free Product Support	(800) 683-7248 or (702) 651-0000	techsupport@jcmglobal.com
<b>After Hours America's Support</b>		
<p>JCM American prides itself in offering the best Customer Service in the industry. We prove this by offering a 24 hour hotline, where Technical Support Personnel can be reached at any time, 7 days a week. To reach our 24/7 after hour's hotline, just follow these three easy steps:            1.) Call JCM American at (800) 683-7248. 2.) Select "Option 5" and wait for the call to be transferred to the JCM after hour's Technical Support line.            3.) Speak with a certified JCM support technician about your situation.</p>		

JCM is a registered trademark of JCM American Corporation. All other product names mentioned herein may be registered trademarks or trademarks of their respective companies. Furthermore, TM and ® are not mentioned in each case in this publication.